

Agilent U1251A/U1252A Handheld Digital Multimeter

Data Sheet



Key Features

- **50,000 count dual display**
- **Up to 0.025% basic DC voltage accuracy**
- **True RMS AC, AC+DC measurements**
- **J-type and K-type temperature measurements**
- **Built-in 20 MHz frequency counter**
- **Built-in programmable square wave generator**
- **Manual and automatic data logging**
- **Built-in battery charging capability**
- **CAT III 1000 V safety protection**
- **Includes: soft carrying case, calibration report, data logging software, test leads, alligator clips, SMT grabbers, mini grabber, fine tip test probes.**

Introduction

The Agilent U1250A Series handheld digital multimeter exceeds your expectations of a handheld digital multimeter by delivering more powerful features and performance to better meet the requirements of your applications. The Agilent U1250A Series handheld digital multimeter gives you 4.5 digit resolution with a 50,000 count full scale in dual display with high contrast blue backlighting. It takes accurate reading in true-RMS and basic DC voltage accuracy of up to 0.025%. These features give you the flexibility to perform quick validation measurements or perform tolerance checks and marginal failure troubleshooting.

Save cost and space with 4-in-1 capability

The U1250A Series handheld digital multimeter contains many features that you would expect from a benchtop multimeter. It is a fully-featured digital multimeter with three added functionalities that are needed in today's challenging maintenance environment: frequency counter, waveform generator and thermometer function. It saves the most in cost and space, while giving you the convenience of its powerful capabilities and features.

Find problems quickly

The U1250A Series expands the capability of users beyond typical

measurements. These instruments provide data storage capability which can be done both manually or automatically with the optional PC interface cable. The accompanying Agilent Graphical User Interface (GUI) Datalogging software enables you to customize your datalogging needs and detect anomalies easily in tabular or graphical format. In addition, the U1250A Series increases your confidence in fault findings with its accurate true-RMS measurements. Other features include sophisticated math functions that allow you to manipulate your measurement data and further reduce measurement errors.

Uncompromising ruggedness and safety

Use The U1250A Series handheld digital multimeter with confidence in almost any environment. These instruments come in a robust package with shock absorbing overmold and operate within their rated specifications from -20°C right up to $+55^{\circ}\text{C}$. Furthermore, these instruments are rated at Cat III 1000 V (IEC 61010 Compliant) which allows you to confidently make measurements on building electrical installations, at locations between the main circuit breaker and the mains socket-outlets, including measurements performed on equipment that is permanently connected to the main circuits.

Visit www.agilent.com for more information on Agilent's handheld digital multimeters

Agilent U1250A Handheld Digital Multimeter: A sure benefit for every feature

50,000 count dual display with true-RMS reading capability

Math functions and SHIFT key for versatility and convenience in one single instrument

Broad range of measurement functions, including temperature and capacitance

Built-in battery charging for optimum capacity



Blue LED backlight for better illumination of display

Data logging capability

20 MHz frequency counter

Programmable square wave generator for stimulation of electronic digital circuits

CAT III 1000 V overvoltage protection

U1251A/U1252A DC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION	TEST CURRENT/ BURDEN VOLTAGE	ACCURACY ± (% of reading + No. of Least Significant Digit)	
				U1251A	U1252A
VOLTAGE ⁽¹⁾	50.000 mV	0.001 mV	-	0.05 + 50 ⁽²⁾	0.05 + 50 ⁽²⁾
	500.00 mV	0.01 mV	-	0.03 + 5	0.025 + 5
	1000.0 mV	0.1 mV	-		
	5.0000 V	0.0001 V	-		
	50.000 V	0.001 V	-	0.03 + 5	0.03 + 5
	500.00 V	0.01 V	-		
	1000.0 V	0.1 V	-		
RESISTANCE	500.00 Ω ⁽³⁾	0.01 Ω	1.04 mA	0.08 + 10	0.05 + 10
	5.0000 kΩ ⁽³⁾	0.0001 kΩ	416 μA	0.08 + 5	0.05 + 5
	50.000 kΩ	0.001 kΩ	41.2 μA		
	500.00 kΩ	0.01 kΩ	4.12 μA		
	5.0000 MΩ	0.0001 MΩ	375 nA	0.2 + 5	0.15 + 5
	50.000 MΩ ⁽⁴⁾	0.001 MΩ	187 nA	1 + 10	1 + 5
	500.00 MΩ ⁽⁴⁾	0.01 MΩ	187 nA	N/A	3+10 < 200 MΩ / 8+10 > 200 MΩ
	500.00 nS ⁽⁵⁾	0.01 nS	187 nA	1 + 20	1 + 10
CURRENT	500.00 μA	0.01 μA	0.06 V (100 Ω)	0.1 + 5 ⁽⁶⁾	0.05 + 5 ⁽⁶⁾
	5000.0 μA	0.1 μA	0.6 V (100 Ω)		
	50.000 mA	0.001 mA	0.09 V (1 Ω)	0.2 + 5 ⁽⁶⁾	0.15 + 5 ⁽⁶⁾
	440.00 mA	0.01 mA	0.9 V (1 Ω)		
	5.0000 A	0.0001 A	0.2 V (0.01 Ω)	0.3 + 10	0.3 + 10
	10.000 A ⁽⁷⁾	0.001 A	0.4 V (0.01 Ω)		0.3 + 5
DIODE TEST	-	0.1 mV	1.04 mA	0.05 + 5	

TEMPERATURE & CAPACITANCE SPECIFICATIONS

FUNCTION	THERMOCOUPLE TYPE	RANGE	RESOLUTION	ACCURACY	MEASURING RATE AT FULL SCALE	MAX. DISPLAY
TEMPERATURE	K	-200 ~ 1372 °C/ -328 ~ 2502 °F	0.1 °C/0.1 °F	0.3% + 3 °C/ 0.3% + 6 °F	N/A	N/A
	J ⁽⁸⁾	-210 ~ 1200 °C/ -346 ~ 2192 °F	0.1 °C/0.1 °F	0.3% + 3 °C/ 0.3% + 6 °F	N/A	N/A
CAPACITANCE	-	10.000 nF	0.001 nF	1% + 8	4 times/sec.	11000 counts
	-	100.00 nF	0.01 nF	1% + 5		
	-	1000.0 nF	0.1 nF			
	-	10.000 μF	0.001 μF			
	-	100.00 μF	0.01 μF		1 time/sec.	
	-	1000.0 μF	0.1 μF	0.1 times/sec.		
	-	10.000 mF	0.001 nF	3% + 10	0.01 times/sec	
	-	100.00 mF	0.01 nF			

[1] Input impedance: >1 GΩ for 50 mV~1000 mV ranges. For U1251A, input impedance is 10 MΩ (nominal) for 5V~1000 V ranges. For U1252A, input impedance is 10 MΩ (nominal) in parallel with 1.1 MΩ at dual display.

[2] The accuracy could be 0.05% + 10 for U1251A and 0.05% + 5 for U1252A. Always use the NULL function to zero out the thermal effect before measuring the signal.

[3] The accuracy of 500 Ω and 5 kΩ is specified after NULL function, which is used to subtract the test lead resistance and the thermal effect

[4] For the range of 50 MΩ and 500 MΩ, the R.H. is specified for <60%.

[5] The accuracy is specified for <50 nS and after NULL function with open test lead.

[6] Always use the NULL function to zero out thermal effect with open test lead before measuring the signal. If the NULL function is not used, an additional 20 counts needs to be added to the DC current accuracy. Thermal effect could occur due to the following:

- Wrong operation to measure the high voltage of 50 V ~ 1000 V for resistance, diode, and mV measurements.
- After battery-charging has completed.
- After measuring a current greater than 440 mA, it is suggested that the meter be left to cool down for twice the measuring time used.

[7] Current can be measured up to 10 A continuously. An additional 0.5% needs to be added to the specified accuracy if the signal measured is in the range of 10 A~20 A for 30 seconds maximum. After measuring a current of > 10 A, leave the meter to cool down for twice the measuring time used before application of low current measurement.

[8] Only available in U1252A.

U1251A AC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)			
			FREQUENCY			
			30 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 10 kHz	10 kHz ~ 30 kHz
TRUE RMS AC VOLTAGE	50.000 mV	0.001 mV	1.0+60	0.6+40	1.0+40	1.6+60
	500.00 mV	0.01 mV		0.6+25		
	1000.0 mV	0.1 mV			1.0+25	1.6+40
	5.0000 V	0.0001 V				
	50.000 V	0.001 V				
	500.00 V	0.01 V				
1000.0 V	0.1 V	0.6+40	1.0+40	N/A		

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)		
			FREQUENCY		
			30 Hz ~ 45 Hz	45 Hz ~ 2 kHz	2 kHz ~ 20 kHz
AC CURRENT	500.00 µA ^[2]	0.01 µA	1.5+50	0.8+20	3.0+80
	5000.0 µA	0.1 µA	1.5+40		3.0+60
	50.000 mA	0.001 mA			
	440.00 mA	0.01 mA			
	5.0000 A	0.0001 A	2.0+40(4)		3+60, <3 A/5 kHz
	10.000 A ^[3]	0.001 A			

U1252A AC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)				
			FREQUENCY				
			20 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 10 kHz	10 kHz ~ 20 kHz	20 kHz~100 kHz ^[5]
TRUE RMS AC VOLTAGE	50.000 mV	0.001 mV	1.5+60	0.4+40	0.7+40	0.75+40	3.5+120
	500.00 mV	0.01 mV		0.4+25	0.4+25		
	1000.0 mV	0.1 mV					
	5.0000 V	0.0001 V					
	50.000 V	0.001 V				1.5+40 ^[1]	N/A
	500.00 V	0.01 V					
1000.0 V	0.1 V	0.4+40	0.4+40	1.5+40 ^[1]	N/A		

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)				
			FREQUENCY				
			20 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 20 kHz	20 kHz~100 kHz ^[5]	
AC CURRENT	500.00 µA ^[2]	0.01 µA	1.0+20	0.7+20	0.75+20	5.0+80	
	5000.0 µA	0.1 µA			1.5+20		
	50.000 mA	0.001 mA				3+60, <3 A/5 kHz	N/A
	440.00 mA	0.01 mA					
	5.0000 A	0.0001 A	1.5+20 ^[4]				
	10.000 A ^[3]	0.001 A					

[1] The input signal is lower than the product of 20,000,000 V-Hz (product of voltage and frequency).

[2] Input current >35 mA Arms.

[3] Current can be measured from 2.5 A up to 10 A continuously. An additional 0.5% needs to be added to the specified accuracy if the signal measured is in the range of 10 A ~ 20 A for 30 seconds maximum. After measuring a current of >10 A, leave the meter to cool down for twice the measuring time used before application of low current measurement.

[4] Input current < 3 Arms.

[5] The additional error to be added as frequency >20 kHz and signal input <10% of range: 3 counts of LSD per kHz.

U1252A AC+DC SPECIFICATIONS

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)				
			FREQUENCY				
			30 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 10 kHz	10 kHz ~ 20 kHz	20 kHz~100 kHz ^[1]
TRUE RMS AC VOLTAGE	50.000 mV	0.001 mV	1.5+80	0.4+60	0.7+60	0.8+60	3.5+220
	500.00 mV	0.01 mV	1.5+65	0.4+30	0.4+30	0.8+45	3.5+125
	1000.0 mV	0.1 mV					
	5.0000 V	0.0001 V					
	50.000 V	0.001 V					
	500.00 V	0.01 V				1.5+45	3.5+125 ^[2]
	1000.00 V	0.1 V	0.4+45	0.4+45	1.5+45 ^[2]	N/A	

FUNCTION	RANGE	RESOLUTION	ACCURACY ± (% of reading + No. of Least Significant Digit)		
			FREQUENCY		
			30 Hz ~ 45 Hz	45 Hz ~ 1 kHz	1 kHz ~ 20 kHz
AC CURRENT	500.00 µA ^[3]	0.01 µA	1.1+25	0.8+25	0.8+25
	5000.0 µA	0.1 µA			
	50.000 mA	0.001 mA	1.2+25	0.9+25	0.9+25
	440.00 mA	0.01 mA			
	5.0000 A	0.0001 A	1.8+30 ^[5]	0.9+30	3.3+70, <3 A/5 kHz
	10.000 A ^[4]	0.001 A		0.9+25	

U1251A/U1252A FREQUENCY SPECIFICATIONS^[2]

RANGE	RESOLUTION	ACCURACY	MINIMUM INPUT FREQUENCY
99.999 Hz	0.001 Hz	0.02%+3 <600 kHz	1 Hz
999.99 Hz	0.01 Hz		
9.9999 kHz	0.0001 kHz		
99.999 kHz	0.001 kHz		
999.99 kHz	0.01 kHz		

[1] The additional error to be added as frequency >20 kHz and signal input <10% of range: 3 counts of LSD per kHz.

[2] The input signal is lower than the product of 20,000,000 V-Hz (product of voltage and frequency).

[3] Input current >35 mArms.

[4] Current can be measured from 2.5 A up to 10 A continuously. An additional 0.5% needs to be added to the specified accuracy if the signal measured is in the range of 10 A ~ 20 A for 30 seconds maximum. After measuring a current of >10 A, leave the meter to cool down for twice the measuring time used before application of low current measurement.

[5] Input current < 3 Arms.

U1251A FREQUENCY SENSITIVITY DURING VOLTAGE MEASUREMENT

FREQUENCY SENSITIVITY AND TRIGGER LEVEL FOR U1251A				
INPUT RANGE (Maximum input for specified accuracy = 10 x Range or 1000 V)	MINIMUM SENSITIVITY (R.M.S. Sine Wave)		TRIGGER LEVEL FOR DC COUPLING	
	20 Hz - 100 kHz	>100 kHz ~ 200 kHz	< 100 kHz	>100 kHz ~ 200 kHz
50.000 mV	10 mV	15 mV	10 mV	15 mV
500.00 mV	25 mV	35 mV	60 mV	70 mV
1000.0 mV	40 mV	50 mV	100 mV	150 mV
5.0000 V	0.25 V	0.5 V	0.5 V / 1.25 V (< 100 Hz)	0.6 V
50.000 V	2.5 V	5 V	5 V	6 V
500.00 V	25 V	N/A	50 V	N/A
1000.0 V	50 V	N/A	300 V	N/A

U1252A FREQUENCY SENSITIVITY DURING VOLTAGE MEASUREMENT

FREQUENCY SENSITIVITY AND TRIGGER LEVEL FOR U1252A				
INPUT RANGE	MINIMUM SENSITIVITY (R.M.S. Sine Wave)		TRIGGER LEVEL FOR DC COUPLING	
	20 Hz ~ 200 kHz	>200 kHz ~ 500 kHz	< 100 kHz	>100 kHz ~ 500 kHz
(Maximum input for specified accuracy = 10 x Range or 1000 V)				
50.000 mV	10 mV	25 mV	10 mV	25 mV
500.00 mV	70 mV	150 mV	70 mV	150 mV
1000.0 mV	120 mV	300 mV	120 mV	300 mV
5.0000 V	0.3 V	1.2 V	0.6 V	1.5 V
50.000 V	3 V	5 V	6 V	15 V
500.00 V	30 V < 100 kHz	N/A	60 V	N/A
1000.0 V	50 V < 100 kHz	N/A	120 V	N/A

DUTY CYCLE^[1]

MODE	RANGE	ACCURACY AT FULL SCALE
DC Coupling	0.01% ~ 99.99%	0.3% per kHz + 0.3%

PULSE WIDTH^[1]

MODE	RANGE	ACCURACY AT FULL SCALE
500 ms	0.01 ms	0.2% + 3
2000 ms	0.1 ms	0.2% + 3

[1] Positive or negative pulse width must be greater than 10 μ s, and the duty cycle range should be considered. The pulse width range is determined by the frequency of the signal.

U1251A/U1252A FREQUENCY SENSITIVITY DURING CURRENT MEASUREMENT

INPUT RANGE	MINIMUM SENSITIVITY (R.M.S. Sine Wave) 20 Hz ~ 20 kHz
500.00 μ A	100 μ A
5000.0 μ A	250 μ A
50.000 mA	10 mA
440.00 mA	25 mA
5.0000 A	1 A
10.000 A	2.5 A

PEAK HOLD (Capturing changes)

SIGNAL WIDTH	ACCURACY FOR DC mV/VOLTAGE/CURRENT
Single event > 1 ms	2% + 400 for all ranges
Repetitive > 250 μ s	2% + 1000 for all ranges

U1252A FREQUENCY COUNTER SPECIFICATIONS

Divide 1 (secondary display "-1-")

RANGE	RESOLUTION	ACCURACY \pm (% of reading + No. of Least Significant Digit)	SENSITIVITY	MIN. INPUT FREQUENCY
99.999 Hz	0.001 Hz	0.02% + 3 0.002% + 5, < 2 MHz	100 mV R.M.S.	0.5 Hz
999.99 Hz	0.01 Hz			
9.9999 kHz	0.0001 kHz			
99.999 kHz	0.001 kHz			
999.99 kHz	0.01 kHz		200 mV R.M.S.	
9.9999 MHz	0.0001 MHz			

Divide 100 (secondary display "-100-")

RANGE	RESOLUTION	ACCURACY \pm (% of reading + No. of Least Significant Digit)	SENSITIVITY	MIN. INPUT FREQUENCY
9.9999 MHz	0.0001 MHz	0.002% + 5, < 20 MHz	400 mV R.M.S.	1 MHz
99.999 MHz	0.001 MHz		600 mV R.M.S.	

U1252A SQUARE WAVE OUTPUT

OUTPUT ^[1]	RANGE	RESOLUTION	ACCURACY
FREQUENCY	0.5, 1, 2, 5, 10, 15, 20, 25, 30, 40, 50, 60, 75, 80, 100, 120, 150, 200, 240, 300, 400, 480, 600, 800, 1200, 1600, 2400, 4800 Hz	0.01 Hz	0.005% + 2
DUTY CYCLE ^[2]	0.39% ~ 99.60%	0.390625%	0.4% of full scale ^[3]
PULSE WIDTH ^[2]	1/Frequency	Range/256	0.2 ms + Range/256
AMPLITUDE	Fixed 0 ~ +2.8 V	0.1 V	0.2 V

[1] Output impedance: 3.5 kΩ maximum.

[2] The positive or negative pulse width must be greater than 50 μs for adjusting the duty cycle or pulse width under different frequency. Otherwise, the accuracy and range will be different from the definition.

[3] For signal frequencies greater than 1 kHz, an addition of 0.1% per kHz is added to the accuracy.

OPERATING CHARACTERISTICS

Measuring rate

Function	Times/second
ACV	7
ACV + dB	7
DCV	7
AC + DC V	2
Ω / nS	14
Diode	14
Capacitance	4 (< 100 μF)
DCI	7
ACI	7
AC + DC I	2
Temperature	6
Frequency	2 (> 10 Hz)
Duty cycle	1 (> 10 Hz)
Pulse width	1 (> 10 Hz)

DECIBEL (dB) CALCULATION

dB BASE	REFERENCE	DEFAULT REFERENCE
1 mΩ (dBm)	1-9999 Ω	50 Ω
1 V (dBV)	1 V	1 V

GENERAL SPECIFICATIONS

DISPLAY Both primary and secondary displays are 5 digit on the LCD display. Both the primary and secondary displays offer a maximum resolution of 50,000 counts. Automatic polarity indication.
POWER CONSUMPTION 105 mVA / 420 mVA (with backlight) maximum (U1251A) 165 mVA / 480 mVA (with backlight) maximum (U1252A)
BATTERY TYPE 9 V Alkaline battery (ANSI/NEDA 1604A or IEC 6LR61) 9 V Carbon-zinc battery (ANSI/NEDA 1604D or IEC6F22) 9 V Ni-MH Rechargeable battery

GENERAL SPECIFICATIONS ... continued

OPERATING ENVIRONMENT Full accuracy at -20 °C to 55 °C Full accuracy to 80% RH for temperatures up to 35 °C, decreasing linearly to 50% RH at 55 °C Altitude: 0 – 2000 meters per IEC 61010-1 2nd Edition CAT III, 1000 V 2000 – 3000 meters per IEC 61010-1 2nd Edition CAT III, 600 V
STORAGE COMPLIANCE -40 °C to 70 °C
SAFETY COMPLIANCE Certified by CSA for IEC/EN/CSA/UL 61010-1 2nd Edition and CAN/CSA 22.2 61010-1 2nd Edition.
MEASUREMENT CATEGORY CAT III 1000 V Overvoltage Protection up to 2000 m, Pollution degree 2
EMC COMPLIANCE Certified to IEC/EN 61326: 2002, CISPR 11, and equivalents for Group 1, Class A
COMMON MODE REJECTION RATIO (CMRR) > 90 dB at DC, 50/60 Hz + 0.1% (1 kΩ unbalanced)
NORMAL MODE REJECTION RATIO (NMRR) > 60 dB at DC, 50/60 Hz + 0.1%
Crest Factor < 3.0
TEMPERATURE COEFFICIENT 0.15 * (specified accuracy)/°C (from 20 °C to 18 °C or 28 °C to 55 °C)
SHOCK and VIBRATION Tested to IEC/EN 60068-2
DIMENSIONS (WxDxH) 203.5 mm x 94.4 mm x 59.0 mm
WEIGHT <ul style="list-style-type: none"> • 504±5 g with battery (U1251A) • 527±5 g with battery (U1252A)
CHARGING TIME (only U1252A) < 220 minutes approx. at the environment of 10 °C to 30 °C.
WARRANTY 3 years


Accessories included:

- Soft carrying case
- Certificate of Calibration (CoC)
- Test Report
- Test leads
- Alligator clips
- SMT grabbers
- Mini grabber
- Fine tip test probes
- Quick Start Guide
- Reference CD containing the User's and Service Guide, application software and instrument drivers
- Alkaline 9 V battery (U1251A only)
- Rechargeable Ni-MH battery with power adapter provided (U1252A only)

Optional Accessories (sold separately):

- U1161A Extension test lead kit
- U1173A IR to USB cable
- U1180A Thermocouple lead kit

DIMENSIONS

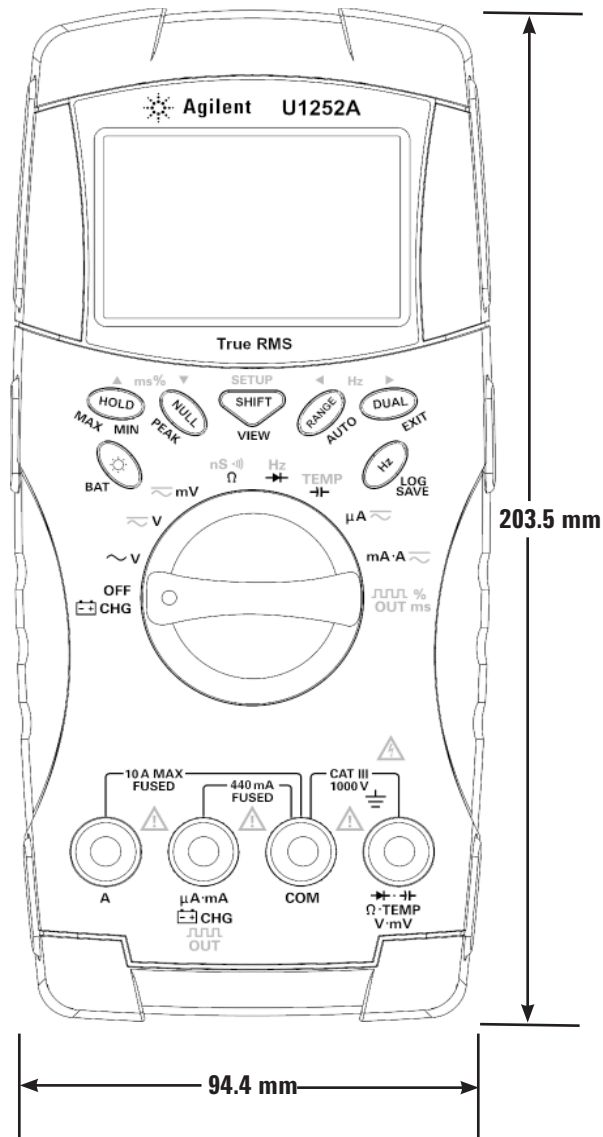



Agilent Email Updates

www.agilent.com/find/emailupdates
Get the latest information on the products and applications you select.



Agilent Direct

www.agilent.com/find/agilentdirect
Quickly choose and use your test equipment solutions with confidence.



www.agilent.com/find/open
Agilent Open simplifies the process of connecting and programming test systems to help engineers design, validate and manufacture electronic products. Agilent offers open connectivity for a broad range of system-ready instruments, open industry software, PC-standard I/O and global support, which are combined to more easily integrate test system development.

Remove all doubt

Our repair and calibration services will get your equipment back to you, performing like new, when promised. You will get full value out of your Agilent equipment throughout its lifetime. Your equipment will be serviced by Agilent-trained technicians using the latest factory calibration procedures, automated repair diagnostics and genuine parts. You will always have the utmost confidence in your measurements.

Agilent offers a wide range of additional expert test and measurement services for your equipment, including initial start-up assistance, onsite education and training, as well as design, system integration, and project management.

For more information on repair and calibration services, go to:

www.agilent.com/find/removealldoubt

www.agilent.com

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

www.agilent.com/find/contactus

Americas

Canada	(877) 894-4414
Latin America	305 269 7500
United States	(800) 829-4444

Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Thailand	1 800 226 008

Europe & Middle East

Austria	0820 87 44 11
Belgium	32 (0) 2 404 93 40
Denmark	45 70 13 15 15
Finland	358 (0) 10 855 2100
France	0825 010 700*
	*0.125 € fixed network rates
Germany	01805 24 6333**
	**0.14€/minute
Ireland	1890 924 204
Israel	972-3-9288-504/544
Italy	39 02 92 60 8484
Netherlands	31 (0) 20 547 2111
Spain	34 (91) 631 3300
Sweden	0200-88 22 55
Switzerland (French)	41 (21) 8113811(Opt 2)
Switzerland (German)	0800 80 53 53 (Opt 1)
United Kingdom	44 (0) 118 9276201

Other European Countries:

www.agilent.com/find/contactus

Revised: October 24, 2007

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2006-2008

Printed in USA, April 03, 2008

5989-5509EN



Agilent Technologies